

Timemachine 01 headset - SAFETY NOTICE

Purpose of the check and adjust operation:

There have been cases reported of tire-downtube interference due to improper headset adjustment. The following procedure is needed in order to make sure the bike is safe to ride:

Procedure:

STEP A:

Check and adjust the headset as described on page 25 of the Timemachine manual:

1. Tighten the **Headset Bolt** to **8Nm** using a Shimano Spline BB Tool:




- a. Check for play in the headset assembly
- b. Tighten as necessary

2. Install the **Stopper Bolt** 2 complete rotations




Step 2

3. Rotate the **Headset Bolt** clockwise until closest indent aligns with **Stopper Bolt**

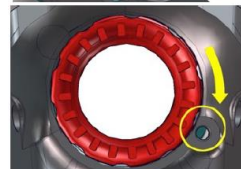

Step 3

4. Tighten **Stopper Bolt** to **4Nm**

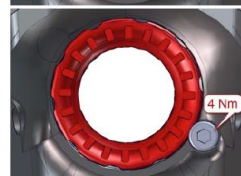

Step 4

STEP B:

After properly checking and adjusting the headset, check if the clearance between downtube and tire is $>4\text{mm}$

If the clearance between the top of the tire and the downtube is less than 4mm, please stop riding the bike immediately and contact BMC for further instructions.